


# TECHNICAL DATASHEET

## TIGRIS 30W IP65

08-02-2021

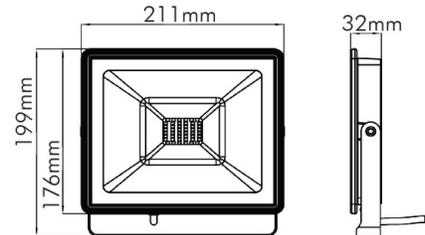

VT/TIGRIS/30W/SMD/3000K/IP65/220V/LED FLOODLIGHT

NOTES

### General Informations

Stock Code	3020750
HSC/GTIP Code	9405.40.10.00.00
EAN-13 (Inbox Barcode)	6970233831693
ITF-14 (Outbox Barcode)	36970233831694

### Electrical Characteristics

Current Type	AC
Operation Voltage	220-240 Volt
Operation Frequency	50/60 Hertz
Electrical Current	0,15 Amper
Power	30 Watt
Power Factor	>0.9
Luminous Efficiency	95 lumen/Watt
Energy Savings	0,82
Dimmable	No
Electrical Protection Class	Class I

### Electrical Component Specifications

Component Fitting Type	Internal Driver
Driver Input Voltage	220-240 Volt
Driver Input Current	0,15 Amper

### Lighting Characteristics

Luminous Flux	2850 lumen
Time for 60% of Lumen	<0.5 seconds
Light Beam Angle	120°
Flicker	No
LED Type	SMD

### Mechanical Parameters

IP Protection Class	IP65
Switch On/Off Cycle	15000
Lifetime	50000 hours
Body Material	Glass & Aluminum
Body Colour	White & Grey
Diffuser Material	Tempered Glass
Product Height	176 millimeter
Product Width	211 millimeter
Product Depth	32 millimeter
Ambient Temperature (Ta)	-20°C<Ta<45°C

### Logistic Informations

Inbox Length	210 millimeter
Inbox Width	215 millimeter
Inbox Height	47 millimeter
Outbox Length	445 millimeter
Outbox Width	415 millimeter
Outbox Height	240 millimeter
Outbox Volume	0,04432 m <sup>3</sup>
Outbox Quantity	16 pieces
Unit Net Weight	0,96 kilogram
Outbox Net Weight	15,36 kilogram
Outbox Gross Weight	17,22 kilogram

IMPORTANT NOTES: VITO reserves the right to change/remove models or specifications partially/completely without any notice. Information, models and photographs of the products in this technical datasheet can not be used, reproduced or republished without permission. However, some parts can be quoted by giving reference and/or chapter number belonging to technical datasheet. Most of the items in the datasheet have been designed by our company within indicated technical specifications inside. Our company is not responsible for errors caused by wrong installation and operating against rules according to qualifications specified in the product details. Photographs printed in this datasheet may not reflect the actual color of the product depending on printing conditions. In the same context, typographical errors may possibly be found in the texts.